


TITLE			D3000 PROGRAMMABLE ARRAY J123		PIB NO. DK-3008
PRODJCT LINE	TAPE DISK FORMATTER	EQUIPMENT CHANGED Logic PCBA 102831, 102821-xx	MODEL SERIES AFFECTED D3000		EFFECTIVE DATE 2-7-74

CLASS OF BULLETIN:	ORDER PART KIT NO.	EFFECTIVITY
<input type="checkbox"/> IMPROVEMENT <input type="checkbox"/> RETROFIT ON FAILURE <input type="checkbox"/> RETROFIT RECOMMENDED <input checked="" type="checkbox"/> INFORMATION ONLY <input type="checkbox"/> _____	N/A	ALL MODEL D3000 DISK DRIVES NOTE: THIS PIB DK-3008 REPLACES SERVICE INFORMATION NOTE DK-3003 IN ITS ENTIRETY. REMOVE & DESTROY SIN DK-3003.

On prints (102831) for Logic PCBA and (102821) for Logic Wire/Wrap, notes should be made that J123 installs upside down. This is only valid for J123 as all other arrays install with Pin 1 (See Fig. 1) in the upper left corner of the socket. J123 installs with Pin 1 in the lower right corner of the socket. Incorrect installation of J123 will result in the wrong frequency at logic board test point 16 causing wrong sector counts on certain models of the D3000.

FIG. 1

Corner cut denotes
Pin 1

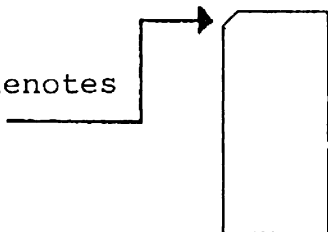

Should Additional Information Be Required — Contact

PERTEC

PERIPHERAL EQUIPMENT DIVISION
 9600 Irondale Avenue, Chatsworth, California 91311
 Phone (213) 882-0030 / TWX (910) 494-2093
 ATTENTION: PRODUCT SUPPORT MANAGER

PERTEC 20-00128 (1)

Distribution Code - 6318