

PERIPHERAL EQUIPMENT DIVISION

TITLE CONNECTOR HARNESS STRAIN RELIEF				PIB NO. DK 3045	
PRODUCT LINE:	TAPE DISK FORMATTER	<input type="checkbox"/> <input checked="" type="checkbox"/> <input type="checkbox"/>	EQUIPMENT CHANGED D3000	MODEL SERIES AFFECTED D3000	EFFECTIVE DATE July 1, 1975

CLASS OF BULLETIN:	ORDER PART KIT NO.	EFFECTIVITY
<input checked="" type="checkbox"/> IMPROVEMENT <input type="checkbox"/> RETROFIT ON FAILURE <input type="checkbox"/> RETROFIT RECOMMENDED <input type="checkbox"/> SERVICE INFORMATION ONLY	N/A	All Model D3000 Disk Drives

Folding down the Logic and Servo PCBA's can, in some circumstances, cause the Molex connectors, to ease off their mating pins. Repeated opening and closing of the PCBA's can result in intermittent contact being made to these pins.

This effect can be overcome by the simple operation of removing some of the tie wraps, and making the connector harness less rigid.

Figs. 1 and 2 show views of the harness before and after removing tie wraps.

Additional Information Be Required — Contact

PERTEC

PERIPHERAL EQUIPMENT DIVISION
 9600 Irondale Avenue, Chatsworth, California 91311
 Phone (213) 882-0030 / TWX (910) 494-2093
 ATTENTION: PRODUCT SUPPORT MANAGER
 PERTEC 20 K012C(1)

Distribution Codes 6318

TITLE CONNECTOR HARNESS STRAIN RELIEF

PIB NO.
DK3045

FIG. 1

Showing unit before tie wraps are removed.
Top Load unit pictured,
but improvement applicable
to Front Load units also.

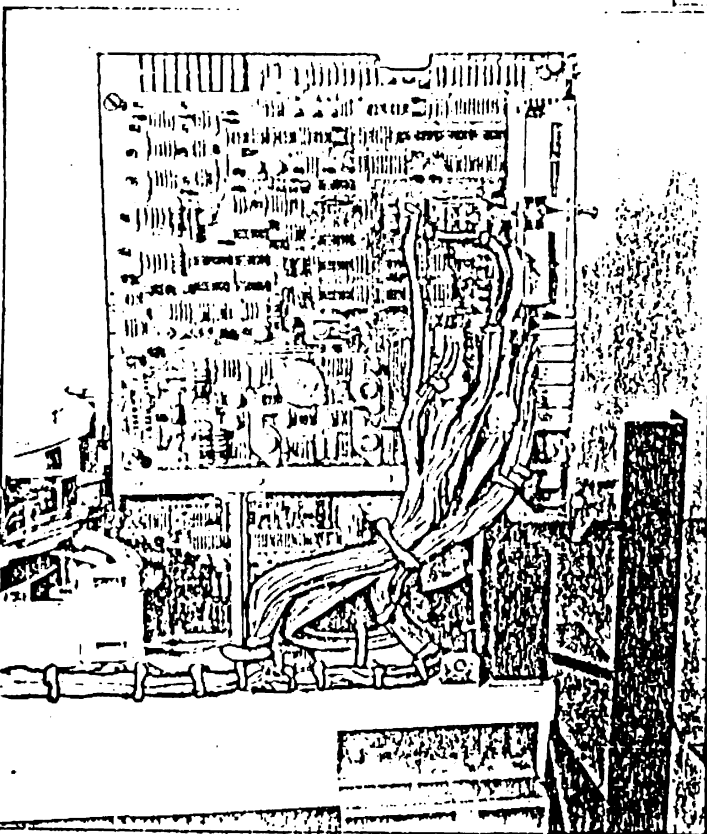
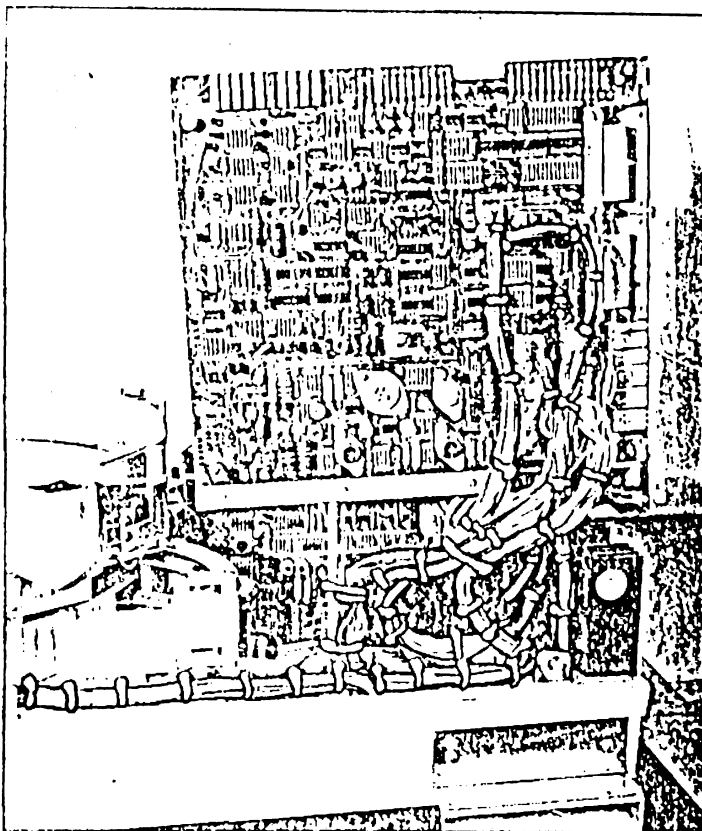


FIG. 2

Unit shown with minimum number
of tie wraps necessary to
keep connector harness tidy.

Note: 15 tie wraps have been
removed.